## **KODAK PROFESSIONAL PORTRA** 800 Film

# Kodak alaris

## **TECHNICAL DATA / COLOR NEGATIVE FILM**

January 2025 • E-4040

KODAK PROFESSIONAL PORTRA 800 Film delivers well balanced color saturation, very fine grain, and best-in-class underexposure latitude. This film is ideal for long lenses and low light situations.

For natural skin tone reproduction, and enhanced color in the most difficult lighting, PORTRA 800 is the film of choice.

TECHNOLOGY	BENEFIT
<ul> <li>Micro-Structure Optimized KODAK T-GRAIN Emulsions</li> <li>KODAK Proprietary Advanced Development Accelerators</li> <li>Antenna Dye Sensitization (High speed films)</li> </ul>	<ul> <li>Noticeably finer grain</li> <li>Enhanced scanning performance</li> <li>Allows for greater enlargement</li> </ul>
<ul><li>Human Eye Spectral Sensitivity</li><li>High-Efficiency Masking Coupler</li></ul>	<ul> <li>Beautiful, natural skin tones</li> <li>Superb color reproduction, even under mixed lighting</li> </ul>
<ul> <li>KODAK Proprietary DIR Couplers</li> </ul>	<ul><li>Optimized sharpness</li><li>Distinct, fine detail</li></ul>
<ul> <li>Precision Sensitometry with extended latitude</li> <li>True-to-speed exposure accuracy</li> </ul>	Best-in-class underexposure latitude     Captures a greater range of brightness     More highlight and shadow detail
Unified Film Emulsion Technology	<ul><li>Single channel printing across speeds and formats</li><li>Album compatibility</li></ul>

#### **SIZES AVAILABLE**

Availability may differ from country to country. See your dealer who supplies KODAK PROFESSIONAL Products.

Size/Format	Base
135	0.10 mm (3.94 mil) ESTAR Thick Base
120	0.10 mm (3.94 mil) ESTAR Thick Base

## STORAGE AND HANDLING

Store unexposed film at 21°C (70°F) or lower in the original sealed package. For extended periods, store film at 13°C (55°F) to preserve consistency.

To avoid moisture condensation on film that has been refrigerated, allow the film to warm up to room temperature before opening the package. Typical warm-up times are given in the table below.

Size	Warm-Up Times (Hours) to Reach Room Temperature of 21°C (70°F) From a Storage Temperature of:			
	2°C (35°F)	13°C (55°F)		
135 magazine	11/2 11/4		1	
120	1 3/4 1/2			

Load and unload roll-film cameras in subdued light. Total darkness is required when you load and unload sheet film holders.

Process film as soon as possible after exposure. Protect negatives from strong light, and store them in a cool, dry place. For long-term storage, keep negatives at a temperature between 2°C (35°F) and 13°C (55°F) and at a relative humidity between 30 and 35 percent.

**Note:** High speed films, such as PORTRA 800 Film, are sensitive to environmental radiation. Expose and process this film promptly. As exposure to radiation is cumulative, you may want to request visual inspection of PORTRA 800 Film at airport and other security x-ray inspection stations.

## DARKROOM RECOMMENDATIONS

Do not use a safelight. Handle unprocessed film in total darkness.

#### **EXPOSURE**

#### Film Speed

Use the speed numbers in the tables below with cameras or meters marked for ISO, ASA, or DIN speeds or exposure indexes (Els). Do not change the film-speed setting when metering through a filter. Metering through filters may affect light meter accuracy; see your meter or camera manual for specific information. For critical work, make a series of test exposures.

Light Source	KODAK WRATTEN Gelatin Filter*	ISO Speed
Daylight or Electronic Flash	None	800
Photolamp (3400 K)	No. 80B	250
Tungsten (3200 K)	No. 80A	200

<sup>\*</sup> For best results without special printing.

#### **Daylight**

Use the exposures in the table below for average frontlit subjects from 2 hours after sunrise to 2 hours before sunset.

Lighting Conditions	Shutter Speed (second) and Lens Opening
Bright or Hazy Sun on Light Sand or Snow	1/1000 f/16
Bright or Hazy Sun (Distinct Shadows)	1/500 f/16 <sup>†</sup>
Weak, Hazy Sun (Soft Shadows)	1/500 f/11
Cloudy Bright (No Shadows)	1/250 f/11
Heavy Overcast or Open Shade‡	1/125 f/11

 $<sup>^\</sup>dagger$  Use f/8 for backlit close-up subjects.

## **Adjustments for Long and Short Exposures**

No filter correction or exposure compensation is required for exposures from 1/10,000 second to 1 second. For critical applications with longer exposure times, make tests under your conditions.

#### **Electronic Flash**

Use the appropriate guide number in the table below as starting-point recommendations for your equipment. Select the unit output closest to the number given by your flash manufacturer. Then find the guide number for feet or metres. To determine the lens opening, divide the guide number by the flash-to-subject distance. If negatives are consistently too dense (overexposed), use a higher guide number; if they are too thin (underexposed), use a lower number.

Unit Output (BCPS)*	Guide Number Distances in Feet/Metres	
350	120/36	
500	140/42	
700	170/50	
1000	200/60	
1400	240/70	
2000	280/85	
2800	340/100	
4000	400/120	
5600	470/140	
8000	560/170	

<sup>\*</sup> BCPS = beam candlepower seconds

## Fluorescent and High-Intensity Discharge Lamps

Use the color-compensating filters and exposure adjustments in the tables below as starting points to expose PORTRA 800 Film under fluorescent or high-intensity discharge lamps. For critical applications, make a series of test exposures under your actual conditions.

To avoid the brightness and color variations that occur during a single alternating-current cycle, use exposure times of 1/60 second or longer with fluorescent lamps; with high-intensity discharge lamps, use exposure times of 1/125 second or longer.

Type of Fluorescent Lamp	KODAK Color Compensating Filter(s)	Exposure Adjustment
Daylight	40R	+ 2/3 stop
White	20C + 30M	+1stop
Warm White	40B	+1stop
Warm White Deluxe	30B + 30C	+ 1 1/3 stops
Cool White	30M	+ 2/3 stop
Cool White Deluxe	10C + 10M	+ 2/3 stop

High-Intensity Discharge Lamp (CCT)	KODAK Color Compensating Filter(s)	Exposure Adjustment
High-Pressure Sodium Vapor	70B + 50C	+ 3 stops
Metal Halide	10R + 20M	+ 2/3 stop
Mercury Vapor with Phosphor	20R + 20M	+ 2/3 stop
Mercury Vapor without Phosphor	80R	+12/3 stops

<sup>\*</sup> Subject shaded from the sun but lighted by a large area of sky.

## **PROCESSING**

Process PORTRA Films in KODAK FLEXICOLOR Chemicals for Process C-41 using the replenishment and wash rates in the tables below. Note that the developer replenishment rates are starting-point recommendations only and may vary due to the amount of exposure to the film, scene content, and the presence/absence of sprocket holes.

## Replenishment and Wash Rates

Film Size	KODAK FLEXICOLOR Developer Replenisher	KODAK FLEXICOLOR Developer Replenisher LORR	KODAK FLEXICOLOR Bleach III, Fixer, and Stabilizer	Wash Water <sup>*</sup>
135	1400 mL/m <sup>2</sup>	700 mL/m²	861 mL/m²	31 L/m <sup>2</sup>
	130 mL/ft <sup>2</sup>	65 mL/ft²	80 mL/ft²	2.9 L/ft <sup>2</sup>
120	1400 mL/m <sup>2</sup>	700 mL/m <sup>2</sup>	1023 mL/m²	31 L/m <sup>2</sup>
	130 mL/ft <sup>2</sup>	65 mL/ft <sup>2</sup>	95 mL/ft²	2.9 L/ft <sup>2</sup>

<sup>\*</sup> Rates are for first wash and a two-stage countercurrent final wash. Double these rates for a single stage final wash.

## **JUDGING NEGATIVE EXPOSURES**

You can check the exposure level with a suitable electronic densitometer equipped with a filter such as a KODAK WRATTEN Gelatin Filter No. 92 or the red filter for Status M densitometry. Depending on the subject and the light source used for exposure, a normally exposed and processed color negative measured through the red filter should have the approximate densities listed below.

Because of the extreme range in skin color, use these red density values for a normally lit forehead only as a guide. For best results, use a KODAK Gray Card (gray side).

	Density Reading			
Area Measured	EI 800	El 1600 (Push 1)	El 3200 (Push 2)	
KODAK Gray Card (gray side) receiving same illumination as subject	0.75 to 0.95	0.85 to 1.05	0.95 to 1.15	
Lightest step (darkest in the negative) of a KODAK Paper Gray Scale receiving same illumination as subject	1.00 to 1.20	1.20 to 1.40	1.40 to 1.60	
Highest diffuse density on normally lighted forehead —light complexion —dark complexion	0.95 to 1.25 0.75 to 1.10	1.10 to 1.40 0.90 to 1.25	1.25 to 1.55 1.00 to 1.35	

#### PRINTING NEGATIVES

This film is optimized for printing to —
KODAK PROFESSIONAL ENDURA Premier Paper
KODAK PROFESSIONAL ENDURA Premier Metallic
Paper

KODAK PROFESSIONAL ENDURA Transparency Display Material

KODAK PROFESSIONAL ENDURA Clear Display Material

## SCANNING NEGATIVES

You can easily scan PORTRA 800 Film negatives with a variety of linear-array-CCD, area-array-CCD, and PMT film scanners. You can scan negatives on desktop scanners as well as high-end drum scanners.

#### **IMAGE STRUCTURE**

#### **Print Grain Index**

The Print Grain Index number refers to a method of defining graininess in a print made with diffuse-printing illumination. It replaces rms granularity and has a different scale which cannot be compared to rms granularity.

- The method uses a uniform perceptual scale, with a change of four units equaling a just noticeable difference in graininess to 90 percent of observers.
- A Print Grain Index rating of 25 on the scale represents the approximate visual threshold for graininess. A higher number indicates an increase in the amount of graininess observed.
- The standardized inspection (print-to-viewer) distance for all print sizes is 14 inches, the typical viewing distance for a 4 x 6-inch print.
- In practice, larger prints will likely be viewed from distances greater than 14 inches, which reduces apparent graininess.
- Print Grain Index numbers may not represent graininess observed from more specular printing illuminants, such as condenser enlargers.

#### Negative Size: 24 x 36 mm (Size 135)


Print Size in inches	4x6	8x10	16x20
Magnification	4.4X	8.8X	17.8X
Print Grain Index	48	70	99

#### Negative Size: 6 x 6 cm (Size 120)


Print Size in inches	4x6	8x10	16x20
Magnification	2.6X	4.4X	8.8X
Print Grain Index	36	48	70

## **CURVES**


## Characteristic Curves, EI 800

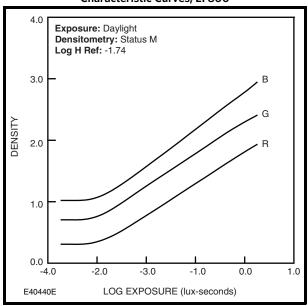


#### Characteristic Curves, El 1600 (Push 1)

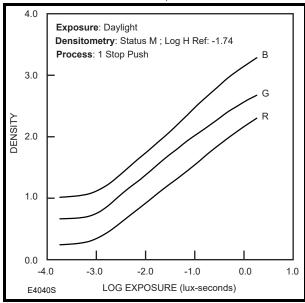

## Characteristic Curves, El 3200 (Push 2)

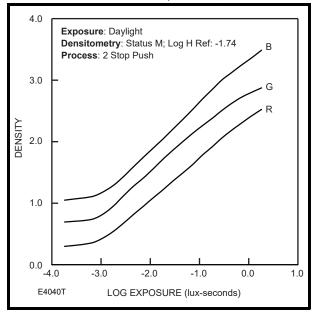


### **Spectral-Sensitivity Curves**

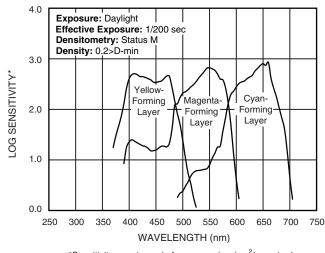


\*Sensitivity = reciprocal of exposure (erg/cm²) required to produce specified density

## **KODAK PROFESSIONAL PORTRA 800 Film**



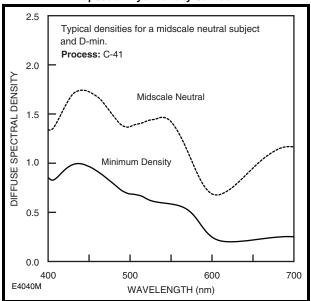

#### **Modulation Transfer Function**

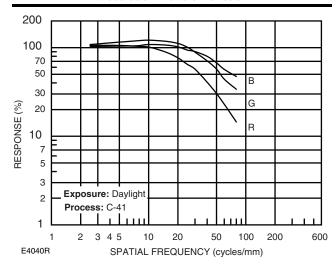

© 2025 Kodak Alaris Inc.

TM: Endura, Flexicolor and Portra

The Kodak, Kodak Professional, Estar, T-Grain and Wratten trademarks are used under license from Eastman Kodak Company.

Revised 1-25

KODAK PROFESSIONAL PORTRA 800 Film KODAK Publication No. E-4040

